



MD 3060 Testing Resistance of the Turbine Speed Sensor

You need to Ohm out pins U and V (See Fig.1) depending on the temp of the transmission at time of test. Below is what you should expect to see when checking.

250 Ω @ -40°F

340 Ω @ 68°F

450 Ω @ 230°F

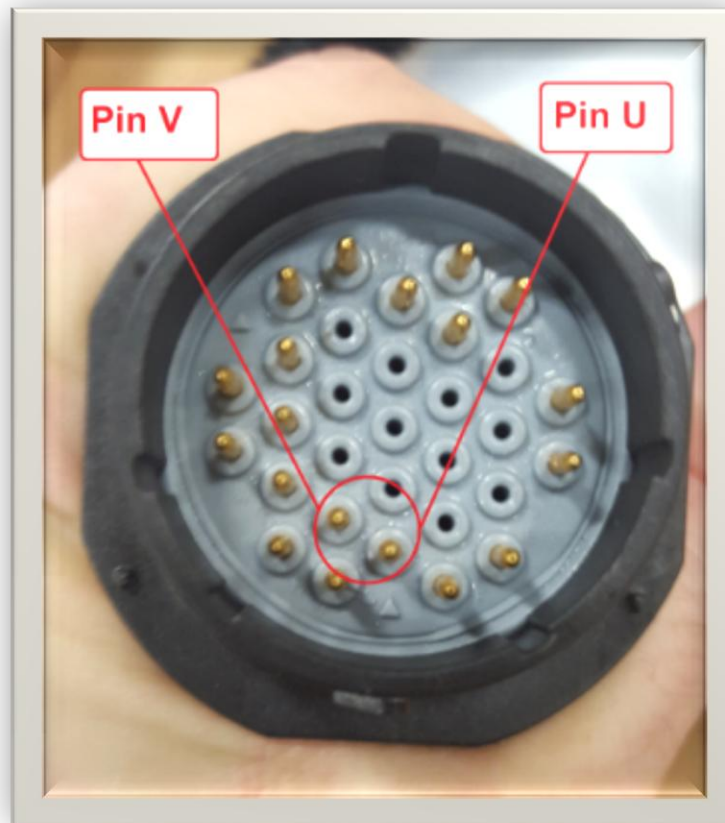


Fig.1

Note: Pay attention to the arrows on connector